2017/04/05 ver.0

# 850nm 50mW 5.6φ TO-Type Laser Diode

#### **Features**


Low operation current Cost effective

## **Applications**

Bar-code scanner Laser printer Sensing

# Absolute maximum ratings

Parameter	Symbol	Condition	Rating	Unit
Light output power	Po	CW	50	mW
Reverse voltage (LD)	$V_{RL}$	-	2	V
Reverse voltage (PD)	$V_{RD}$	-	30	V
Forward current (PD)	I <sub>FD</sub>	-	10	mA
Case temperature	T <sub>C</sub>	-	-10~+50	°C
Storage temperature	Ts	-	-40~+85	°C

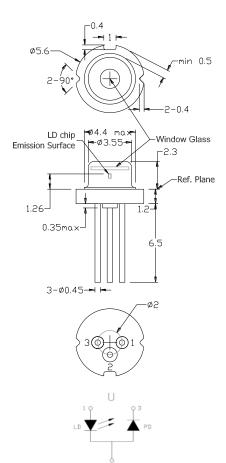

# Electrical and optical characteristics (T<sub>c</sub>=25 °C)

Parameter	Symbol	Min.	Тур.	Max.	Unit	Conditions	
Peak wavelength	λ	840	850	860	nm	P <sub>o</sub> =50 mW	
Threshold current	I <sub>th</sub>	-	25	30	mA		
Operating current	l <sub>op</sub>	-	95	105	mA		
Operating voltage	$V_{op}$	-	1.8	2.4	V		
Differential efficiency	η	0.7	0.8	1.0	mW/mA	P <sub>o</sub> =10-50 mW	
Monitor current	I <sub>m</sub>	0.2	0.5	1.0	mA	$P_o=50$ mW, $V_{RD}=5$ V	
Parallel divergence angle	θ <sub>//</sub>	6	9	12	deg		
Perpendicular divergence angle	$ heta_{\perp}$	26	30	35	deg	P <sub>o</sub> =50 mW	
Parallel divergence angle	Δ θ//	-3	-	+3	deg		
Perpendicular divergence angle	$\Delta \; \theta_{\perp}$	-3	-	+3	deg		
Emission point accuracy	Δ xΔ yΔ z	-80	-	+80	um		

- Do not operate the device above maximum ratings. Doing so may cause unexpected and permanent damage to the device.

  Take precautions to avoid electrostatic discharge and/or momentary power spikes. A change in the characteristics of the laser or premature failure may result.
- Proper heat sinking of the device assures stability and lifetime. Always ensure that maximum operating temperatures are not exceeded.
- Observing visible or invisible laser beams with the human eye directly, or indirectly, can cause permanent damage. Use a camera to observe the laser.
- No laser device should be used in any application or situation where life or property is at risk in event of device failure.
- Specifications are subject to change without notice. Ensure that you have the latest specification by contacting us prior to purchase or use of the product.

### ARIMA LASERS CORP.

PHONE: 886-3-4699800 | FAX: 886-3-4699600 E-MAIL: Ldsales@arimalasers.com | www.arimalasers.com



